


Match Line Drawing -/02

**Note:**  
Existing underground services are shown  
on drawings 23/139/21 to 23/139/25  
(unless noted otherwise).

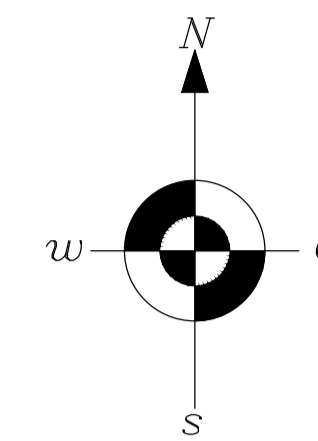

**PLANNING BOUNDARY**  
190725m<sup>2</sup> TOTAL AREA

**TRIAL PIT LOGS**

- TP 47 0.0m - 0.5m: Firm dry fibrous peat.  
At 0.5m: Rock. Difficult to excavate.
- TP 48 0.0m - 0.2m: Firm dry fibrous peat.  
At 0.2m: Rock. Difficult to excavate.
- TP 49 0.0m - 1.2m: Firm dry peat.  
At 1.2m: Rock. Difficult to excavate.
- TP 50 0.0m - 0.3m: Peat.  
At 0.3m: Rock. Difficult to excavate.
- TP 51 0.0m - 0.7m: Peat.  
At 0.7m: Rock. Difficult to excavate.
- TP 52 0.0m - 0.8m: Peat.  
At 0.8m: Rock. Difficult to excavate.

**TRIAL PIT LOGS cld**

- TP 53 0.0m - 0.5m: Firm dry fibrous peat.  
At 0.5m: Rock. Difficult to excavate.
- TP 54 0.0m - 0.6m: Firm dry fibrous peat.  
At 0.6m: Fragmented rock. Difficult to excavate.
- TP 55 0.0m - 0.4m: Firm dry peat.  
0.4m - 0.7m: Silty, sandy gravel.  
At 0.7m: Fragmented rock. Difficult to excavate.
- TP 56 0.0m - 0.9m: Peat.  
At 0.9m: Rock. Difficult to excavate.
- TP 57 0.0m - 0.8m: Peat.  
At 0.8m: Rock. Difficult to excavate.
- TP 58 0.0m - 0.7m: Peat.  
0.7m - 0.8m: Silty, sandy gravel.  
At 0.8m: Fragmented rock. Difficult to excavate.
- TP 59 0.0m - 0.8m: Peat.  
At 0.8m: Rock. Difficult to excavate.
- TP 60 0.0m - 0.5m: Peat.  
At 0.5m: Rock. Difficult to excavate.
- TP 61 0.0m - 0.6m: Peat.  
At 0.6m: Rock. Difficult to excavate.

**TRIAL PIT LOGS cld**

- TP 62 0.0m - 0.2m: Firm dry fibrous peat.  
At 0.2m: Rock. Difficult to excavate.
- TP 63 0.0m - 0.3m: Firm dry fibrous peat.  
At 0.3m: Rock. Difficult to excavate.
- TP 64 0.0m - 0.7m: Firm dry peat.  
At 0.7m: Rock. Difficult to excavate.
- TP 65 0.0m - 0.6m: Peat.  
At 0.6m: Fragmented rock. Difficult to excavate.
- TP 66 0.0m - 0.4m: Peat.  
At 0.4m: Fragmented rock. Difficult to excavate.
- TP 67 0.0m - 0.3m: Peat.  
At 0.3m: Rock. Difficult to excavate.
- TP 68 0.0m - 0.1m: Peat.  
At 0.1m: Rock. Difficult to excavate.
- TP 69 0.0m - 0.2m: Peat.  
At 0.2m: Rock. Difficult to excavate.

**TRIAL PIT LOGS cld**

- TP 70 0.0m - 0.8m: Firm dry fibrous peat.  
At 0.8m: Fragmented rock. Difficult to excavate.
- TP 71 0.0m - 0.4m: Firm dry fibrous peat.  
0.4m - 0.5m: Dry silty, sandy gravel.  
At 0.5m: Fragmented rock. Difficult to excavate.

**PEAT PROBE KEY**

- 0.00
- 0.00 - 0.50
- 0.55 - 1.00
- 1.05 - 1.50
- 1.55 - 2.00
- 2.05 - 2.50
- 2.55 - 3.00
- >3.05

**LEGEND**

	Survey Station
	Survey Point
	Trial Pit
	Edge of Existing Road
	Track/ Hard Verge
	Fence
	Building
	33kV Overhead Electric
	Top of Bank
	Toe of Bank
	Drain
	1m Contour
	0.2m Contour

**FEATURES**

	SV Scour Hydrant
	DAV Double Air Valve
	JB Comms Cable Joint Box
	DP Comms Cable Draw Pit
	SP/MP Sign Post/ Marker Post
	Cul Culvert

PA	Planning boundary amended.	25/03/24	MMI
REV	REVISION NOTE	DATE	INITIALS
		2A STEINISH STORNOWAY HS2 0AA TEL (01851) 704703 EMAIL malcolm@macgoverconsultancy.com	
SCHEME:			
<b>ARNISH ROAD UPGRADE</b>			
TITLE:			
<b>TOPOGRAPHICAL SURVEY PEAT PROBES AND TRIAL PITS SHEET 3 of 5</b>			
SCALE(S):		DATE: NOVEMBER 2023	
A1	1:1000	DRAWN:	MMI
A3	1:2000	CHECKED:	SMI
DRAWING NO.:		23/139/03 <b>PLANNING A</b>	